









Cart Runner 300 244

1-1. Safety Symbol Definitions

	<p>DANGER! – Indicates a hazardous situation which, if not avoided, will result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.</p>		<p>Cylinders contain gas under high pressure and can explode if damaged. Never let a welding electrode touch any cylinder. Always secure cylinder to running gear, wall, or other stationary support.</p>
	<p>Indicates a hazardous situation which, if not avoided, could result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.</p>		<p>Welding processes cause flying pieces of metal and slag. Wear safety glasses with side shields.</p>
<p>NOTICE</p> 	<p>Indicates statements not related to personal injury.</p> <p>Indicates special instructions.</p>		<p>Trailers Falling equipment can cause serious personal injury and equipment damage. Use lifting eye to lift unit only, not trailer, gas cylinders, or any other accessories. Use equipment of adequate capacity to lift unit or parts such as engine or generator.</p> <p>Running Gear Falling equipment can cause injury and damage, oversized cylinder can cause tipping. Properly install and secure all equipment onto cart before using cart. Always secure or remove any tools stored on cart before moving unit. Do not lift cart in any manner when equipment and cylinder(s) are installed – use handles to move cart. Do not overload handles with cables – use standard 10 to 15 foot cables as maximum lengths.</p>
	<p>Beware of electric shock from welding electrode or wiring. Touching the electrode while in contact with the work or ground can cause electric shock. Always wear dry gloves. Keep all panels and covers closed.</p>		
<p>CALIFORNIA PROPOSITION 65 WARNINGS</p> <p>Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Section 25249.5 et seq.)</p> <p>This product contains chemicals, including lead, known to the state of California to cause cancer, birth defects, or other reproductive harm. <i>Wash hands after use.</i></p>			

1-2. Assembled Cart & Cylinder Rack



Overall Dimensions		
	Inches	Millimeters
Length	41-1/2	1054
Width	23-1/4	591
Height	45-1/4	1149
Weight	73 lb	33 Kg

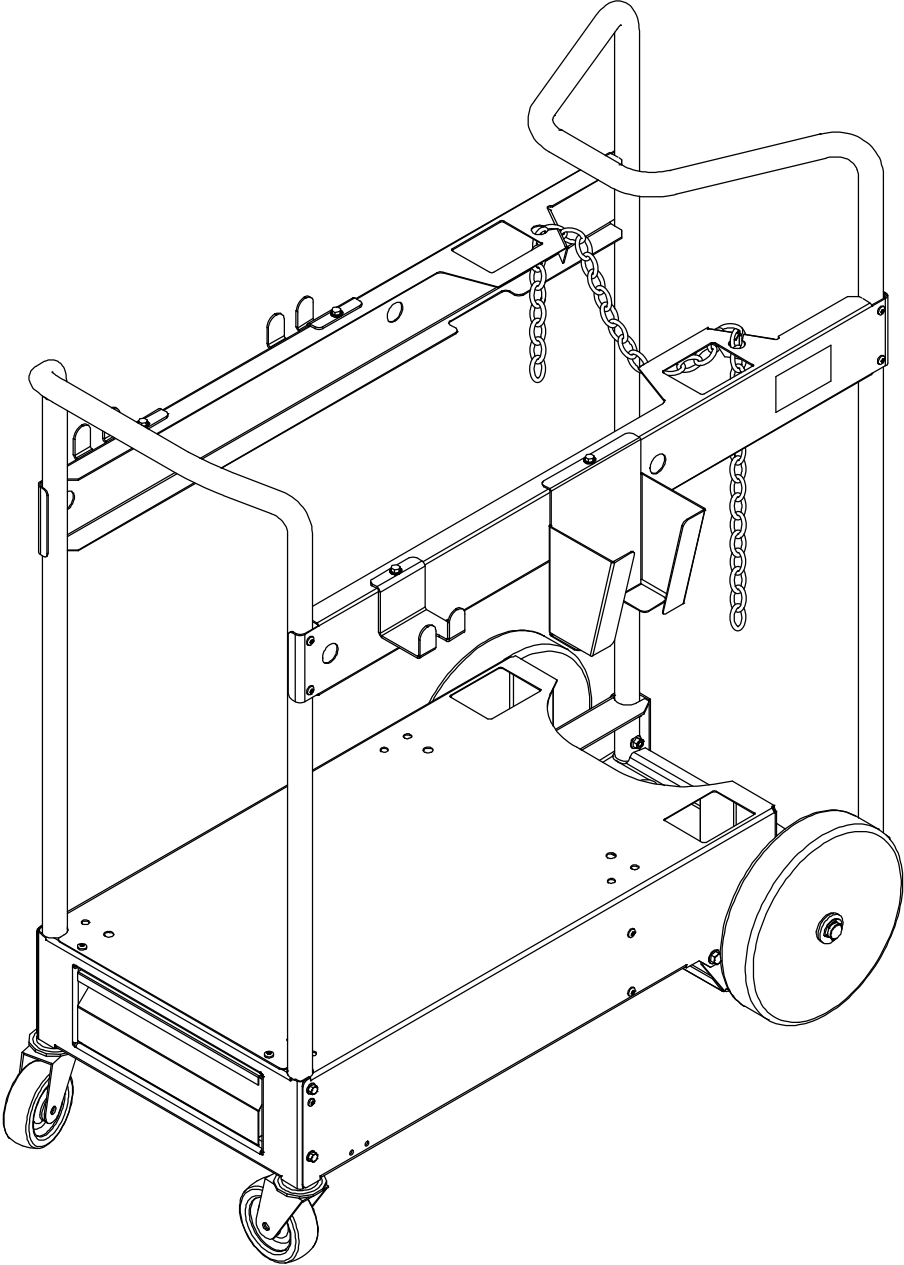

1-3. Typical Cart With Welding Power Source, Cooling System, And Gas Cylinder



⚠ Be careful when placing or moving unit over uneven surfaces. Tipping or falling equipment can cause injury and damage equipment.

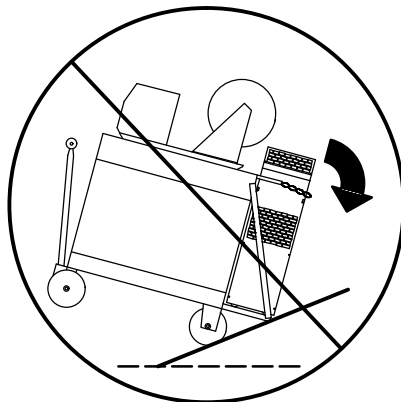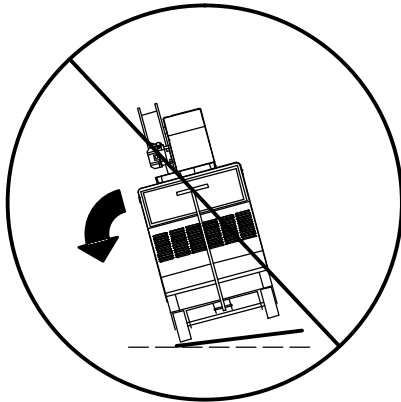


- 1 Gas cylinder - Not Supplied
- 2 Chain

Obtain and install gas cylinder. Secure gas cylinder with chain.

- 3 Foot Control - Not Supplied
- 4 Foot Control Holder
- 5 Cable Holders (3)

Install foot control holder and cable holders in any of the screw holes located on top of side rails. Secure with supplied .250-20X .50 hex head screws.


- 6 Cooling System - Not Supplied
- 7 Cart
- 8 Welding Power Source - Not Supplied

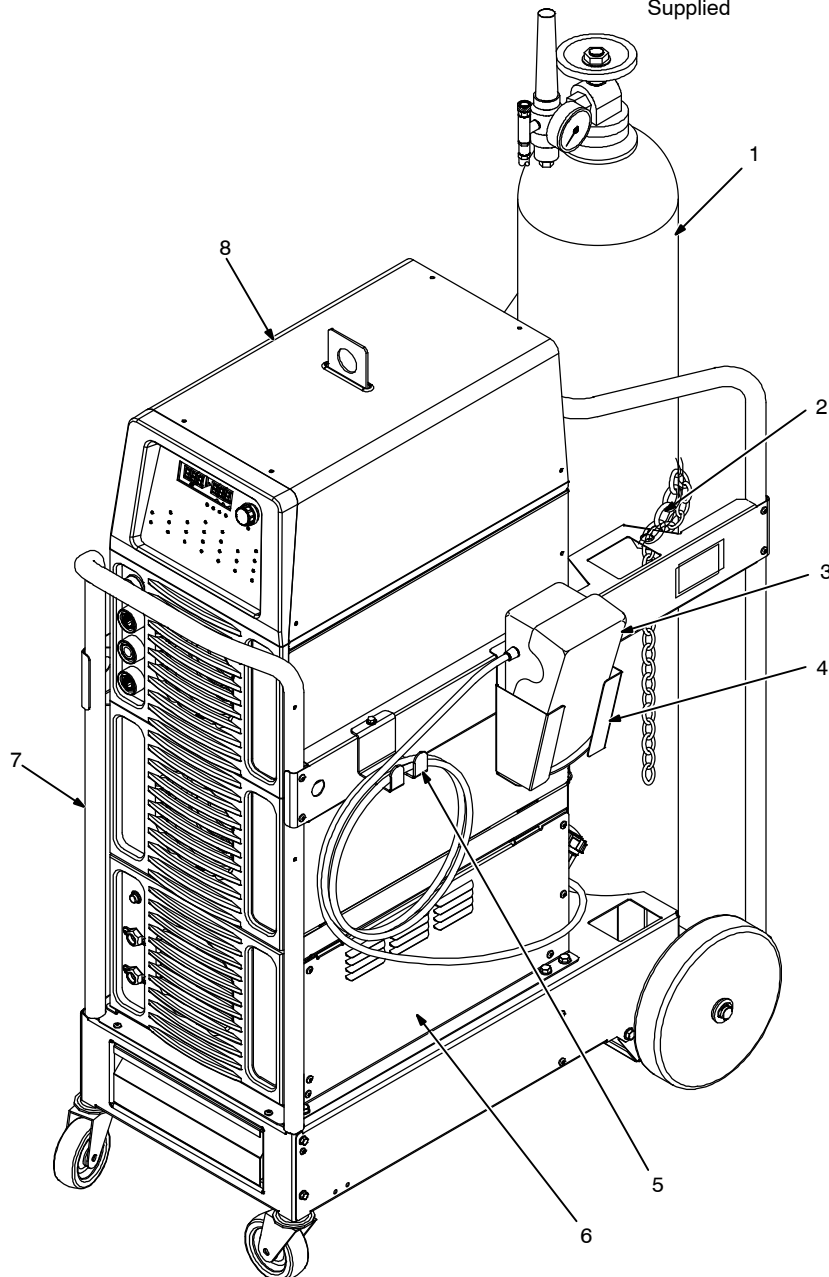

Tools Needed:



1-4. Cart Parts List

 Hardware is common and not available unless listed.

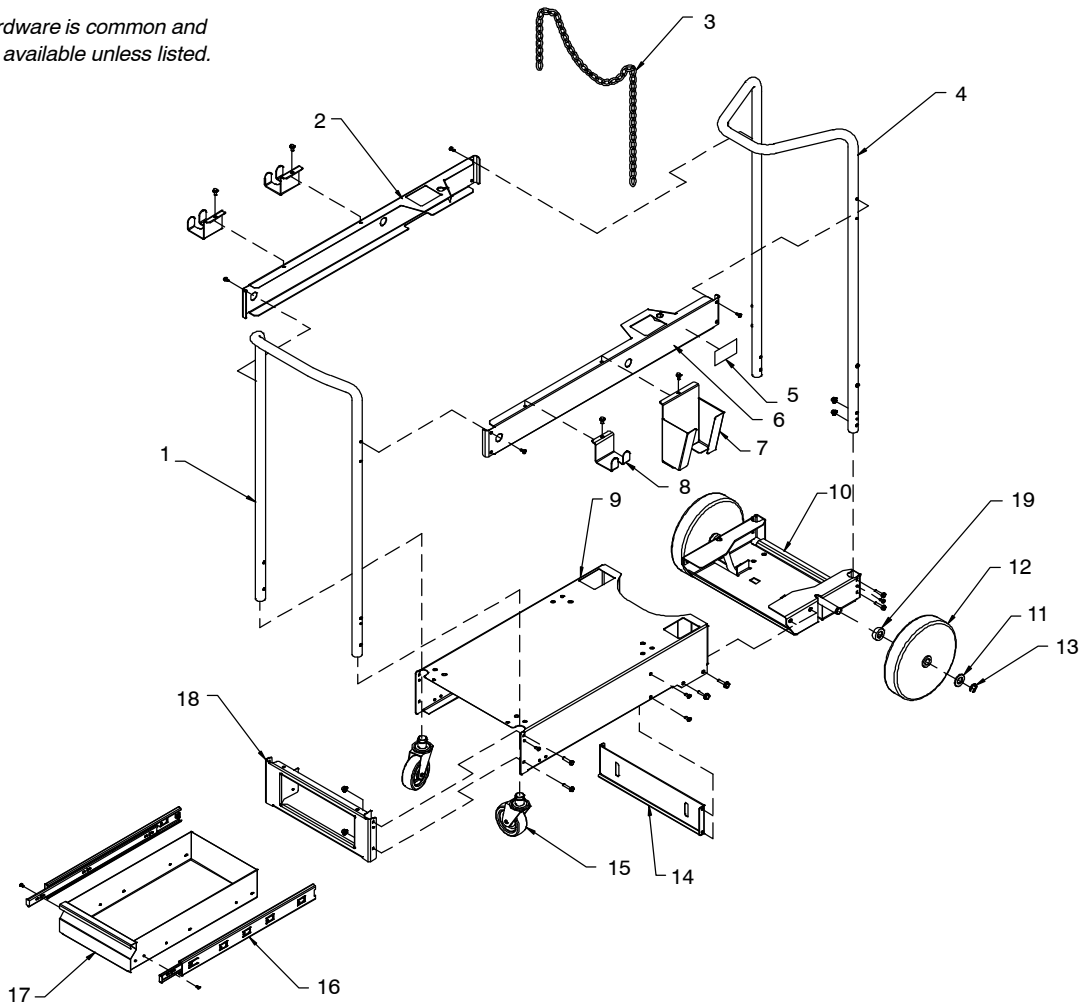


Figure 1-1. Complete Assembly

804 872-B

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
230 157 Figure 1-1 Complete Cart Assembly.				
...	1	226 927	Handle, Cart	1
...	2	+226 929	Panel, Side Rail LH	1
...	3	210 224	Chain, Straight Link 1/0 X 27 Bright Zinc Pld	1
...	4	226 926	Support, Bottle	1
...	5	192 236	Label, Caution Over Turning Can Cause Injury	2
...	6	+226 930	Panel, Side Rail RH	1
...	7	199 403	Holder, Foot Control	1
...	8	191 875	Hanger, Cable/Torch	3
...	9	226 919	Base, Cart	1
...	10	226 920	Tray, Bottle Assy	1
...	11	602 250	Washer, Flat .812 ID x 1.469 OD x .134t Stl Pld Ansi .750	2
...	12	209 869	Wheel, Poly-olefin 10 In Dia x 2.000 wide x .750	2
...	13	121 614	Ring, Rtnng Ext .750 Shaft X .085 Thk E Style Pld	2
...	14	226 925	Support, Base Drawer Slides	1
...	15	226 923	Caster, Swvl 4.00 In Polyolefin	2
...	16	216 594	Slide, Drawer Full Extension	2
...	17	191 884	Drawer,	1
...	18	228 585	Base, Front Panel	1
...	19	235 506	Spacer	2

To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.
 +When ordering a component originally displaying a precautionary label, the label should also be ordered.